

Gove Peninsula Waste Management Facility

Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021



Prepared by



East Coast Environmental Pty Limited

ABN 50 604 871 178

18 Gippsland Circuit, Forest Lake,

Queensland 4078

Phone: 0467703868

eastcoastenv@bigpond.com

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Report Title:	Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2020
Project:	Gove Peninsula Waste Management Facility
Client:	Nhulunbuy Corporation
Report No.:	115005_REO_007_REV A
Draft/Final:	Final

Apart from fair dealing for the purposes of private study, research, criticism, or review as permitted under the Copyright Act, no part of this report, its attachments or appendices may be reproduced by any process without the written consent of East Coast Environmental Pty Limited.

East Coast Environmental Pty Limited and the authors responsible for the preparation and compilation of this report do not have, nor expect to have a beneficial interest in this project and will not benefit from any of the recommendations outlined in this report.

The preparation of this report has been in accordance with the project brief provided by the client and has relied upon the information, data and results provided or collected from the sources and under the conditions outlined in the report.

All maps and information contained within this report are prepared for the exclusive use of the Client to accompany this report for the land described herein and are not to be used for any other purpose or by any other person or entity. No reliance should be placed on the information contained in this report for any purposes apart from those stated therein. East Coast Environmental Pty Limited accepts no responsibility for any loss, damage suffered or inconveniences arising from, any person or entity using the plans or information in this report.

Table of Revisions for Document No. 115005_REO_007_REV A

Revision	Date	Description	Author	Reviewer	Approved
A	31/11/2021		B. Campbell	LT	
0	9/12/2020	Final	B. Campbell		

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Table of Contents

Introduction	3
1.1 Introduction.....	3
1.2 Outline of the WGMP	3
1.3 Site Context.....	4
1.3.1 Site Hydrology and Hydrogeology	5
1.4 Weather.....	6
1.4.1 Groundwater, Surface Water and Leachate Sampling 2016	6
Methodology	8
2.1 Landfill Gas Monitoring	8
2.2 Leachate Monitoring	9
2.3 Surface Water Monitoring	10
2.4 Groundwater Monitoring.....	10
Results 11	
3.1 Landfill Gas Monitoring results	11
3.2 Groundwater Monitoring.....	12
3.2.1 Groundwater heights.....	12
3.2.2 Groundwater Physiochemical Results September 2020	12
3.2.3 Groundwater Metals and Metalloid Results September 2020	15
3.2.4 Groundwater Ammonia, Nitrogen and Phosphorus Results September 2020	19
3.2.5 Total Petroleum/Total Recoverable /Polynuclear Aromatic Hydrocarbons and BTEXN Results September 2020	20
Discussion and Recommendations	24
4.1 Landfill Gas Monitoring	24
4.2 Surface Water Monitoring	24
4.3 Leachate Monitoring	24
4.4 Groundwater Monitoring.....	24
4.4.1 Physicochemical results.....	25
4.4.2 Dissolved Metals.....	25
4.4.3 Hydrocarbon, BTEX, PCB and Pesticide contamination.	25
Conclusion 27	
References 28	

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Introduction

1.1 Introduction

East Coast Environmental Pty Limited was commissioned by Nhulunbuy Corporation (NC) to prepare a Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report for the Gove Peninsula Waste Management Facility, hereafter referred to as the Waters and Gas Monitoring Plan (WGMP).

The preparation of the monitoring report is required to satisfy conditions of the Northern Territory Environmental Protection Licence (EPL236) issued for the facility.

The objective of this monitoring is to identify the movement of any potential contaminants that may emanate from the landfill operations and enter pathways that could potentially affect the human and environment receptors in the local area.

This Monitoring Report provides details on the;

- Location undertaken for monitoring,
- methodology for each monitoring type (Leachate, Surface water, Groundwater and Landfill gas)
- parameters monitored for each of the environmental aspects,
- results for the monitoring period.

The Monitoring report has been prepared generally in accordance with;

- Northern Territory Environment Protection Authority (2013) *Guidelines for the Siting, Design and Management of Solid Waste Disposal Sites in the Northern Territory*
- Northern Territory Environment Protection Authority (2016) *Guideline for Reporting on Environmental Monitoring*
- Northern Territory Environment Protection Authority (2013) *Guidelines for Consultants Reporting on Environmental Issues*
- East Coast Environmental (2016) *Gove Peninsula Waste Management Facility -Conceptual Site Model;*
- East Coast Environmental (2016) *Gove Peninsula Waste Management Facility - Landfill Gas Assessment*

1.2 Outline of the WGMP

The report is structured as follows:

Section 2 – Provides the site context, a description of the sites location and the operational history of the site,

Section 3 – Details the gas sampling methodology undertaken and the modelling approach used for the Landfill Gas Assessment,

Section 4 – Provides a summary of the results of the initial Landfill Gas sampling and landfill Gas generation modelling,

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Section 5 – Provides a discussion of the results, landfill gas risk and mitigation/ management measures,

Section 6 – Details the conclusions of the Landfill Gas Assessment.

1.3 Site Context

The site is located approximately 3km southeast of the Nhulunbuy Post Office, approximately 4.3km by road. The site is situated within the current Mineral Reserve R0238 and is adjacent to the Nhulunbuy Speedway on Melville Bay Road.



Figure 1: Locality plan of Gove Peninsula Waste Management Facility.

Gove Peninsula Waste Management Facility – Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021

1.3.1 Site Hydrology and Hydrogeology

Hydrology

No surface water was encountered during the 2003 or 2016 site investigations and the site lacked any natural incised drainage channels or creeks. Evidence of channelised flow was only found along road sides and constructed drainage channels emanating from table drains from the internal access roads and hardstand areas.

Water flow is expected to occur during the wet season as either sheet flow or subsurface water flow, and due to the lack of erosional features or channels is expected to slow, with high percentage of infiltration. The surface water flow direction has been inferred using recent Digital Surface Mapping (DSM) undertaken during the drilling program and baseline groundwater sampling conducted in July 2016. The inferred surface water flow direction is expected to travel in an east to west direction as shown by the direction of surface flows and the DSM is shown in **Figure 2**.

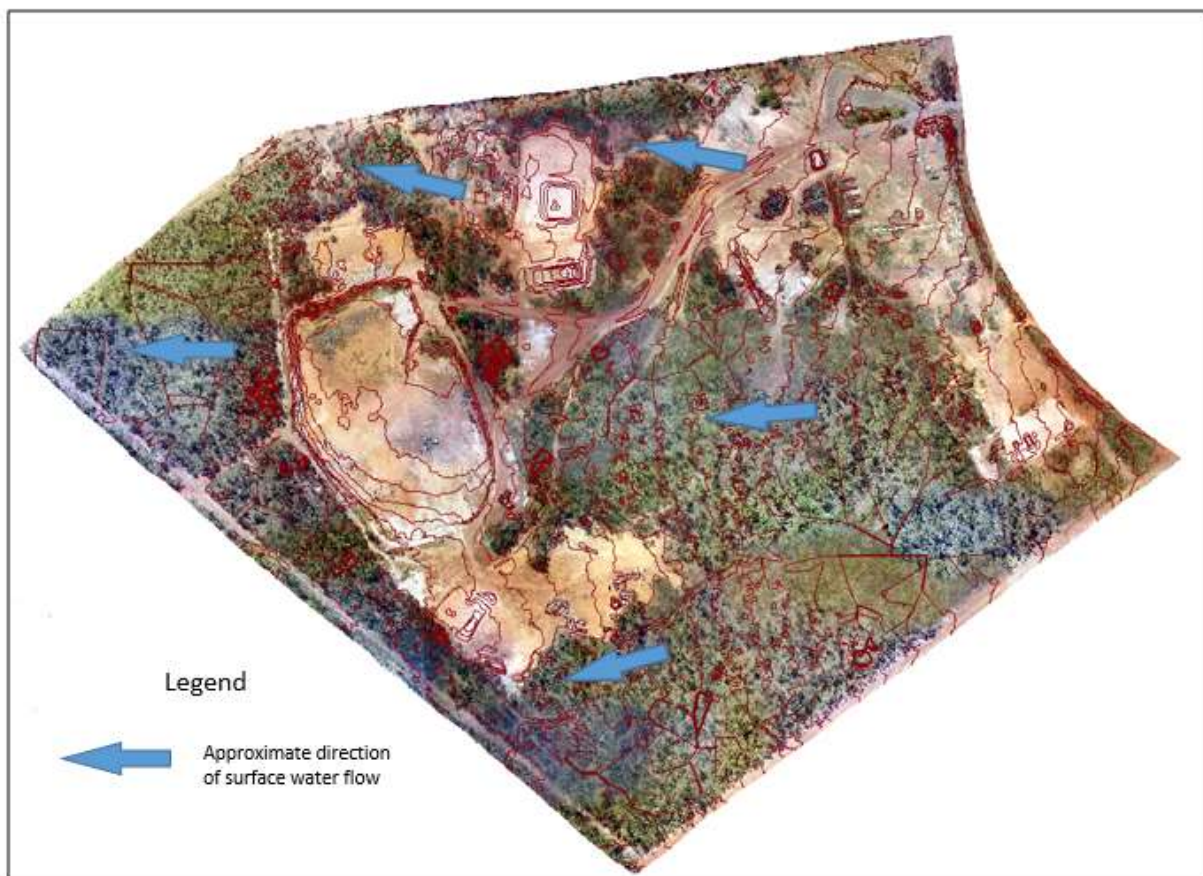


Figure 2: Inferred direction of surface flows and DSM at Gove Peninsula Waste Management Facility

Groundwater and Hydrogeology

Groundwater was encountered at boreholes deeper than 6m below ground level during the 2003 drilling program. The groundwater depth was identified by the “balling” of returned cuttings during the drilling program as standing water was only recorded in one borehole during the program and therefore a piezometric surface could not be determined across the site (GHD 2003).

Gove Peninsula Waste Management Facility – Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021

1.4 Weather

The weather experienced prior to the sampling saw warmer than average days and nights across virtually all of the Northern Territory. Territory-wide, temperatures were above average for every month during the dry season, apart from May. All months of the dry season, apart from September, saw below average rainfall for the NT.

This follows on from back-to-back dry wet seasons and nearly the entire Northern Territory saw below average rainfall totals during the 2019-20 wet season. Both daytime and overnight temperatures both ranked as the second-highest on record as nearly all locations had temperatures in the highest 10% of their long-term record.

Rainfall 2019/2020

During 2020 the Northern Territory had a second season of below average rainfall, immediately following a dry 2018-19 wet season. Territory-wide, rainfall was 20% below the long-term average. Only a few parts of the eastern NT saw average or above average rainfall for the wet season. The north-western, the far north, and the south-western NT, had seasonal rainfall totals in the lowest 10% of historical records since 1900. The primary climate driver responsible for the low rainfall was the near-record strong positive Indian Ocean Dipole (IOD) which dominated Australia during the second half of 2019. The positive IOD contributed to the late monsoon onset of 18 January, 3 weeks later than average. Following this initial monsoon activity, two other relatively weak and short-lived monsoon bursts were observed, contributing to moderate widespread rainfall over the NT. Below average tropical low/cyclone activity during 2019-20 also contributed to the relatively dry conditions (BOM 2020).

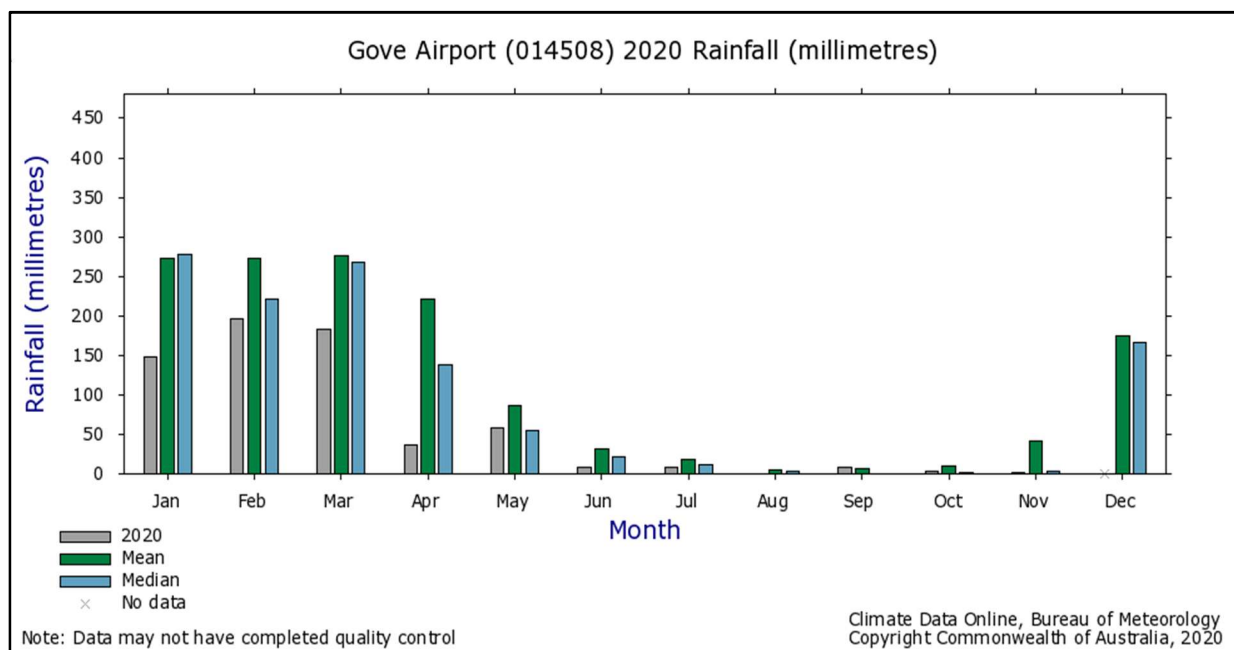


Figure 3a: Rainfall Data 2020 at Gove Airport

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Rainfall 2020/2021

Most parts of the Northern Territory recorded above average rainfall during the wet-season months of October to April. Temperatures were generally warmer than average in the north and near or below average in the southern Territory, with cool days observed in the south-west. For the first wet season since 2015–16, no tropical cyclones passed over Northern Territory waters.

Rainfall totals during the wet season were generally above average; Territory-wide, rainfall was 21% above the long-term average, and the highest since the wet season of 2016-17. Four of the 7 months of the wet season saw above average rainfall across the Territory, starting with an unusually wet October (2020) as La Niña became established in the Pacific Ocean. A relatively dry start to January 2021 was followed by a monsoon burst late in the month, although rainfall was 20% below average overall for the month.

Monsoonal conditions continued into early February, leading to above average rainfall. While rainfall in the northern half of the Territory was below average during March, tropical low activity affected southern and western areas, leading to slightly above average rainfall for the month. The final month of the wet season saw mostly dry conditions during April, with no monsoonal activity affecting the Territory.

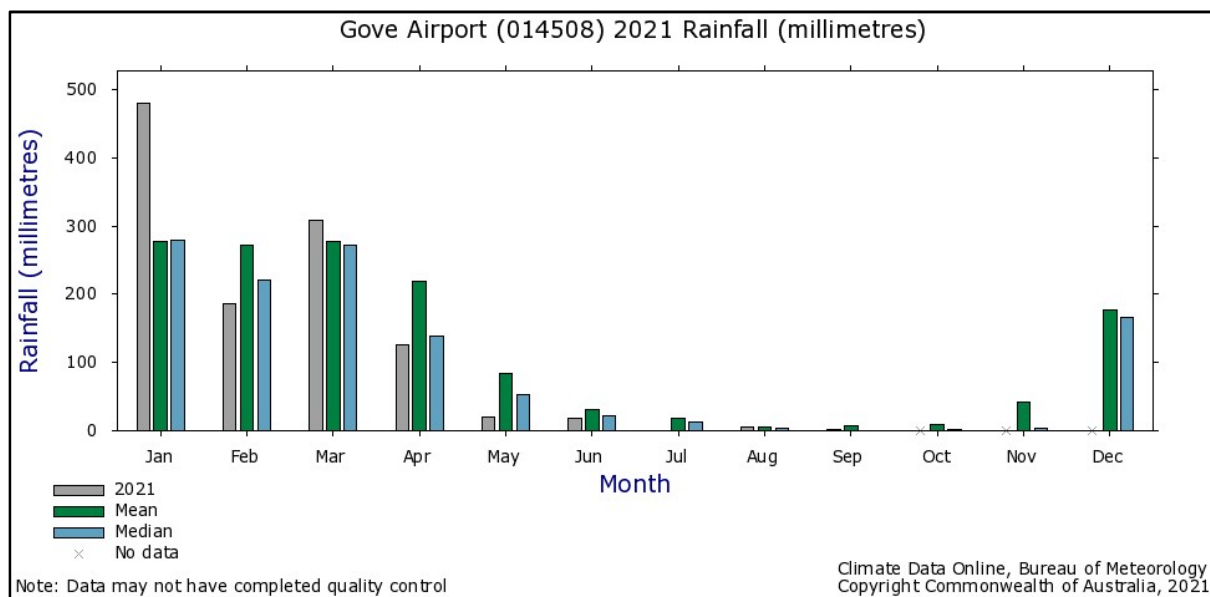


Figure 3b: Rainfall Data 2021 at Gove Airport

Gove Peninsula Waste Management Facility – Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021

Methodology

The 2021 monitoring was undertaken over a two day period on the 9th and 10th September 2020. The following provides the methods employed for Leachate, Surface Water, Groundwater and Landfill Gas Monitoring.

2.1 Landfill Gas Monitoring

The Landfill Gas Monitoring sampling approach was to identify the gas concentrations within the landfill cells and whether any vertical or horizontal LFG migration could be detected. The sampling of the Leachate/LFG monitoring bores was conducted on the two new Landfill Gas boreholes, and three shallow bores (to 5.5m) installed in 2003 at the base of the landfill cells.

The dedicated Landfill Gas Monitoring was conducted at two wells was installed into the centre of each of the two capped landfill cells, to a depth of approximately 6m below ground surface within the waste mass and at 3 shallow Leachate wells to determine if any migration of Landfill gas was occurring.

All bores were fitted with an Ex Cap Vapour extraction 2" Locking Monitoring Well Expansion Plug, with Air Sampling Ports and the insitu gas composition was analysed at all five bores and the two ambient air sampling sites using the Landtec GA5000 Portable Landfill Gas Analyser. The details of each monitoring bore is shown in Table 1 and the location of each bore is provided on Figure 2.

Detailed gas composition sampling was undertaken at the two LFG bores (LFG 01 and LFG02) using soil gas canisters.



Figure 4: Landfill Gas Monitoring Bores installed at Gove Peninsula Waste Management Facility.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Table 1: Details on Leachate and Landfill Gas Monitoring Bores

Monitoring Bore Name	Monitoring Bore Type	Depth	Notes
LL01	Leachate and Landfill Gas Migration Bore	Approximately 5.5m Below ground surface	Within 10 m of landfill, Ex -cap fitted to existing bore installed in 2003
LL02	Leachate and Landfill Gas Migration Bore	Approximately 5.5m Below ground surface	Ex -cap fitted to existing bore installed in 2003
LL03	Leachate and Landfill Gas Migration Bore	Approximately 5.5m Below ground surface	Ex -cap fitted to existing bore installed in 2003
LG01	Landfill Gas Bore	Approximately 6.0m into landfill waste	Installed during 2016 – slotted pipe grouted to surface
LG02	Landfill Gas Bore	Approximately 6.0m into landfill waste	Installed during 2016 – slotted pipe grouted to surface



Figure 5: Landfill Gas Monitoring - Gove Peninsula Waste Management Facility

2.2 Leachate Monitoring

During the May 2021 monitoring only 2 of the leachate bores contained water to enable the collection of samples for leachate monitoring.

Gove Peninsula Waste Management Facility – Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021

2.3 Surface Water Monitoring

The site has only contains ephemeral water channels and no permanent standing water bodies. During the May 2021 surface water monitoring was not undertaken as no surface waters were available for monitoring.

2.4 Groundwater Monitoring

The location of the groundwater boreholes and the relative groundwater heights are shown in **Figure 3**. The heights recorded at each of the groundwater boreholes, and the relative heights are detailed in **Table 2** below. The recent groundwater investigations determined that the groundwater gradient generally follows the terrain as shown in the DSM, in that the flow is generally from east to west.

Table 2: Groundwater Bore information from bore installation program 2016

Groundwater bore No.	Surface elevation (at top of monument)	Depth to groundwater (from monument)	Groundwater elevation (m AHD) #
GW01	17.49	7.21	10.28
GW02	17.22	7.53	9.69
GW03	26.53	10.52	16.01
GW04	28.05	11.83	16.22
GW05	25.08	7.7	17.38
GW06	24.07	11.25	12.82
GW07	17.11	8.18	8.93

Elevation currently approximate and only relative as elevation not rectified from monument.

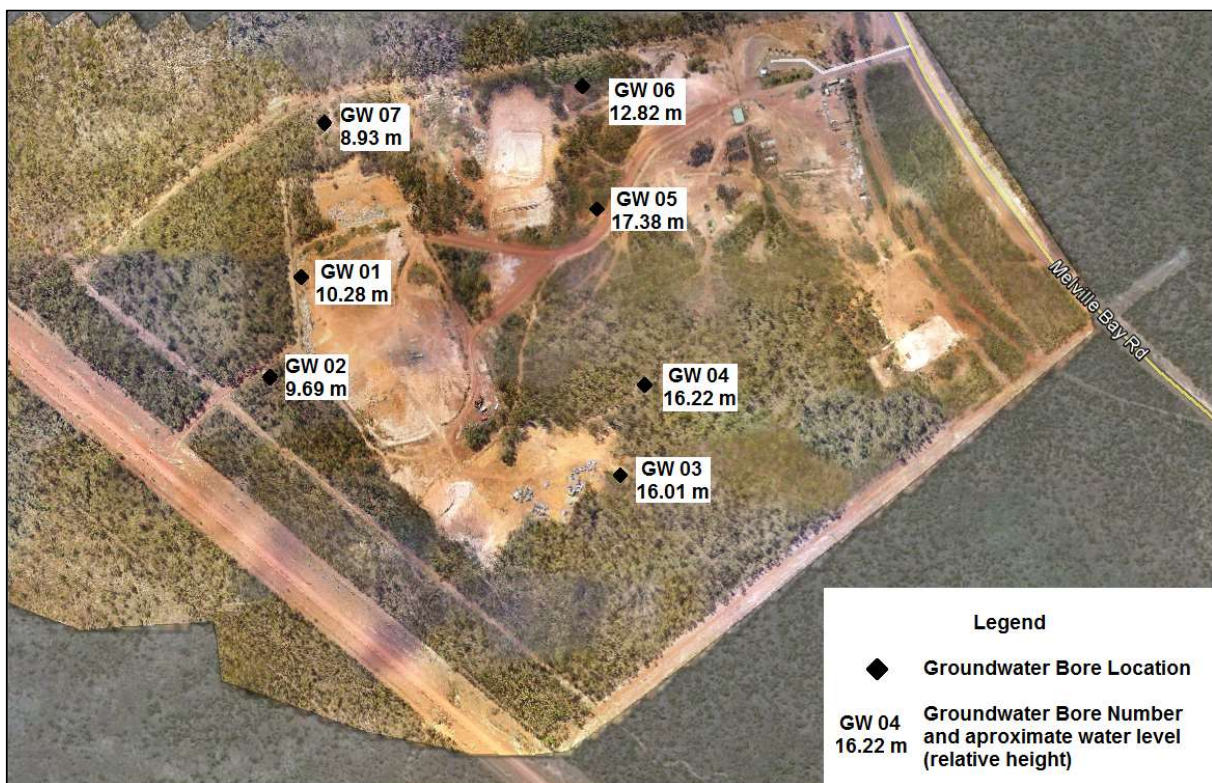


Figure 6: Groundwater boreholes and the relative groundwater heights encountered at Gove Peninsula Waste Management Facility

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Results

3.1 Landfill Gas Monitoring results

The results of the insitu field sampling undertaken in 2016 and 2020 are detailed in Tables 3 and 4 (below).

Table 3: Insitu Gas composition sampling results – Field measurements Baseline 2016

Monitoring Bore /Site	CH ₄ (%)	CO ₂ (%)	O ₂ (%)	CO (ppm)	H ₂ S (ppm)	Balance Gases (%)
LL01	0.1	3.0	18.2	45	3	78.8
LL02	0.0	4.9	16.8	1	1	78.3
LL03	0.1	6.7	13.9	66	6	79.4
LG01	49.0	15.8	0.0	182	7	35.2
LG02	64.7	31.8	0.1	303	29	3.4

Table 4: Insitu Gas composition sampling results – Field measurements May 2021

Monitoring Bore /Site	CH ₄ (%)	CO ₂ (%)	O ₂ (%)	CO (ppm)	H ₂ S (ppm)	Balance Gases (%)
LL01	0.0	7.9	11.9	2	1	80.1
LL02	0.0	0.0	20.5	2	0	79.5
LL03	0.0	10.0	10.5	1	1	79.5
LG01	62.6	10.7	0.0	9	7	26.7
LG02	64.5	34.4	0.0	11	18	1.1

The results demonstrate that the landfill continues to generate significant percentages of Methane in the closed and capped landfill cells. The gas composition recorded in LG01 has observed an increase in Methane levels between 2016 and 2021 from 49.0% to 62.6%. The older of the two cells (LFG 02) shows methane concentrations of approximately 64.7% in 2016, and similar levels in 2021 to 64.5%.

The three Leachate/Landfill gas bores (LL01/LL02/LL03) situated on the edge of the landfill also recorded no Methane (0.0 -0.0%) and extremely low levels of Hydrogen Sulphide (1ppm). Neither of these correlate to typical Landfill gas concentrations.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

3.2 Groundwater Monitoring

3.2.1 Groundwater heights

Table 5: Insitu sampling results – Field measurements

Groundwater bore No.	Surface elevation (at top of monument)	Depth to groundwater (from monument Baseline 2016)	Depth to groundwater (from monument 2019)	Depth to groundwater (from monument 2020)	Depth to groundwater (from monument 2021)	Difference between 2016 to 2021
GW01	17.49	7.21	6.98	11.72	4.23	+ 2.98
GW02	17.22	7.53	7.40	11.19	5.42	+ 2.11
GW03	26.53	10.52	11.42	13.75	13.33	-2.81
GW04	28.05	11.83	12.40	15.08	14.83	-3.00
GW05	25.08	7.7	7.01	10.27	5.23	+2.47
GW06	24.07	11.25	7.88	10.80	6.59	+4.66
GW07	17.11	8.18	5.64	9.39	4.37	+3.81

The recorded groundwater heights showed a significant increase in water levels in May 2021 results in all but two piezometers (GW03 and GW04) with heights generally 2.1 -4.6m above the originals heights after installation. When comparing the heights recorded in 2021 to 2020/2019 at GW03 and GW04 this trend of a drop of approximately 3.0m was observed and was consistent with other groundwater levels recorded.

3.2.2 Groundwater Physiochemical Results May 2021

The recorded Groundwater Physiochemical results are shown in Table 6 below.

Table 6: Groundwater Physiochemical Results May 2021

Date	Site	pH Value (pH Units)	Electrical Conductivity $\mu\text{S}/\text{cm}$	Total Dissolved Solids mg/L	Suspended Solids (SS) mg/L	Turbidity NTU	Redox Potential mV
25/05/2021	GW01	6.53	757	351	472	430	167
25/05/2021	GW02	6.55	252	139	89	86.8	182
25/05/2021	GW03	5.89	836	440	18	19.2	231
25/05/2021	GW04	6.09	265	198	98	100	227
26/05/2021	GW05	5.65	68	42	7	2.4	249
26/05/2021	GW06	4.85	162	136	64	38	299
26/05/2021	GW07	6.03	113	81	29	15.2	259

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

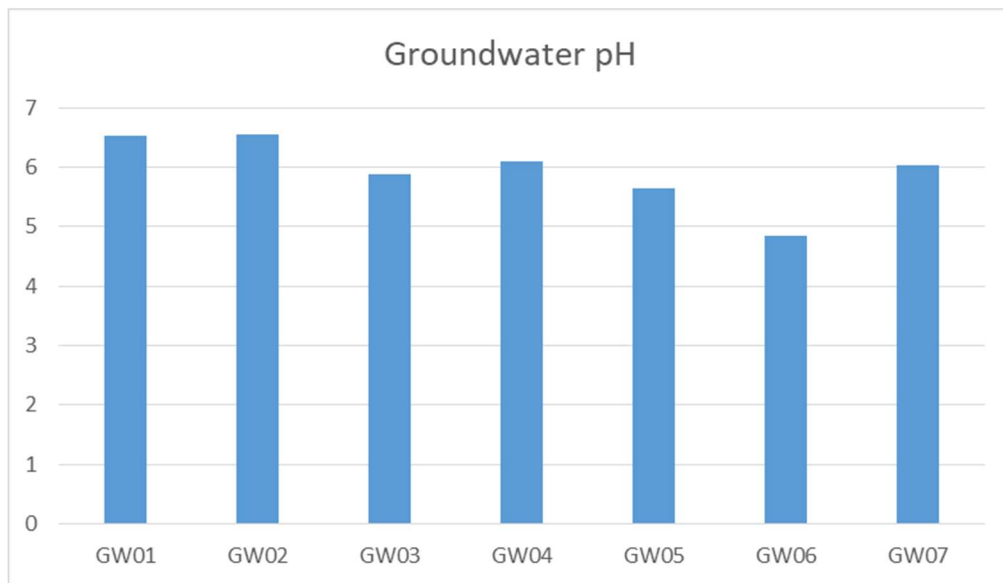


Figure 7: Groundwater pH May 2021

Groundwater pH was relatively consistent across all piezometers apart from GW01 which recorded a neutral pH level. All other piezometers recorded acidic water ranging from 4.85 to 6.55.

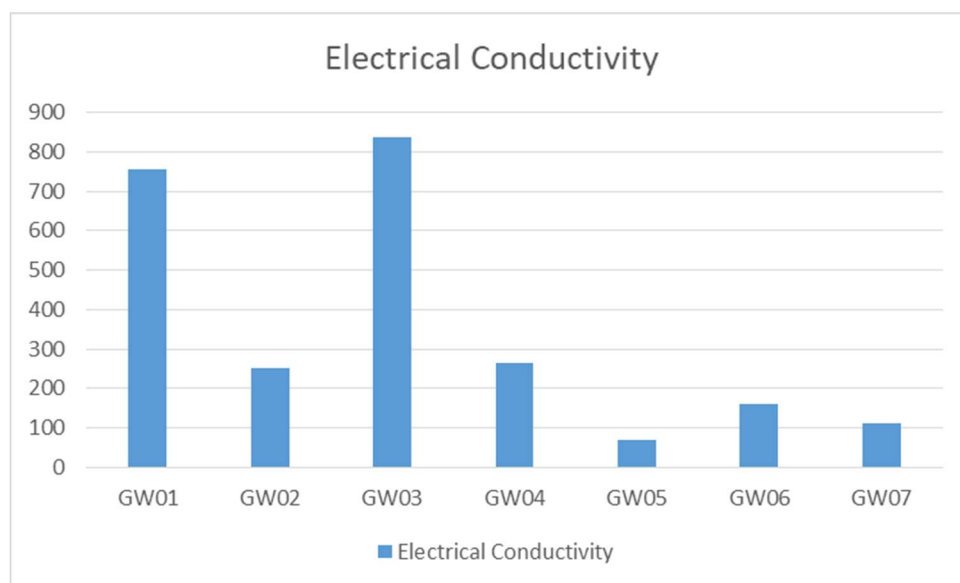


Figure 8: Electrical Conductivity (µS/cm) May 2021

The recorded Electrical Conductivity (EC) varied across piezometers however the piezometers with the highest EC was GW01 down gradient to the recent operational cells and at GW03 which is not located near any current or former landfill cell.

The EC was however consistently lower at the up gradient piezometers GW04, GW05, GW06 and GW07.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

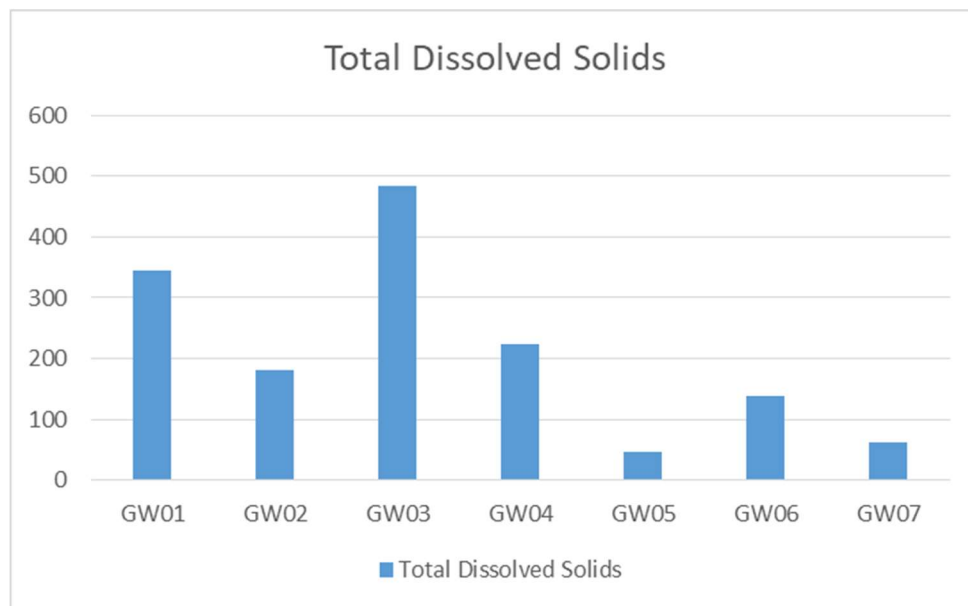


Figure 9: Total Dissolved Solid (TDS) May 2021

Similar to the recorded Electrical Conductivity (EC), TDS varied across piezometers however the piezometers with the greatest variability was GW01 down gradient to the recent operational cells and a GW03 which is not located near any current or former landfill cell.

The EC was however consistently lower at the up gradient piezometers GW04, GW05, GW06 and GW07.

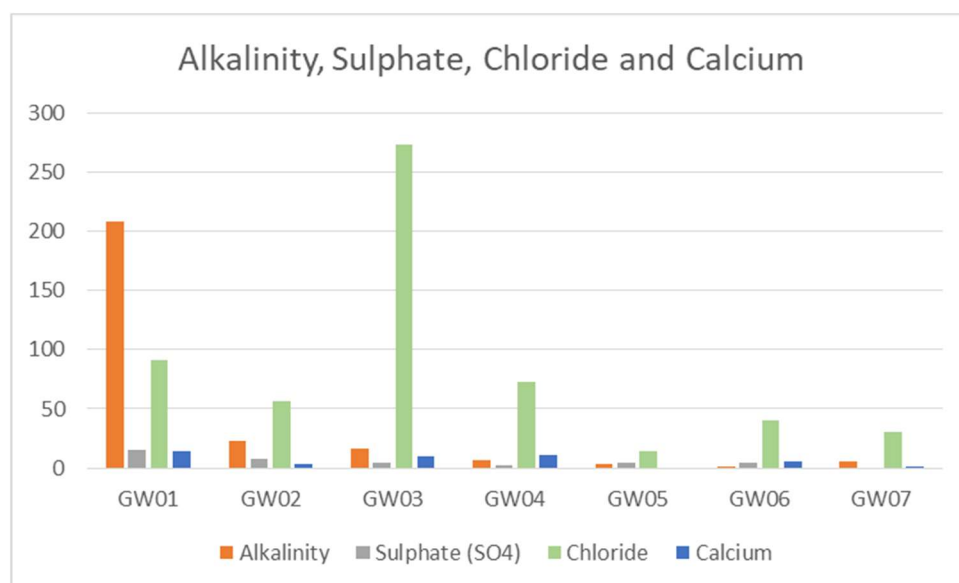


Figure 10: Alkalinity, Sulphate, Chloride and Calcium May 2021

The Alkalinity, Sulphate, Chloride and Calcium also followed the trends of the EC with again GW03 recording highest Chloride levels despite being a significant distance from any cell. GW01 down gradient to the recent operational cells also showed some elevation in Alkalinity, Sulphate, Chloride and Calcium.

Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021

3.2.3 Groundwater Metals and Metalloid Results September 2020

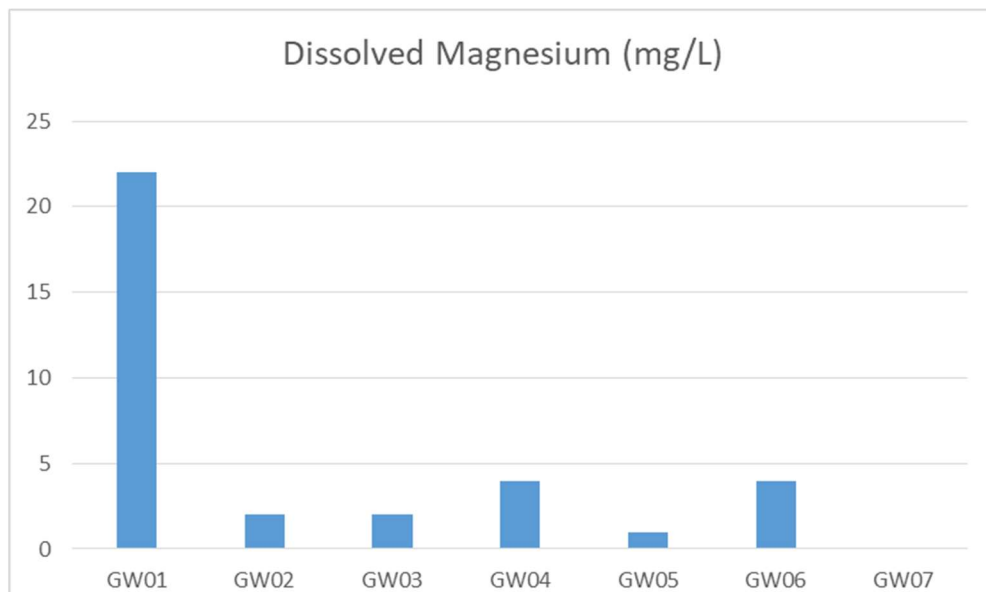


Figure 11: Dissolved Magnesium May 2021

The levels of Dissolved Magnesium were elevated at GW01 down gradient to the recent operational cells while all other piezometers recorded low concentrations.

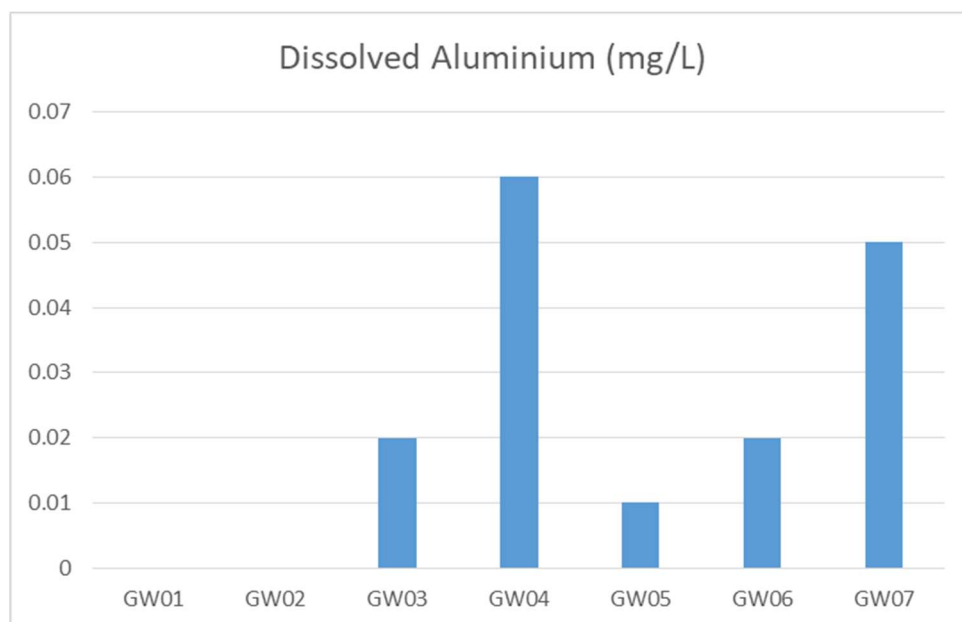


Figure 12: Dissolved Aluminium May 2021

The levels of Dissolved Aluminium were lowest at GW01 down gradient to the recent operational cells and GW05 a “control piezometer”, while all other piezometers recorded low concentrations.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

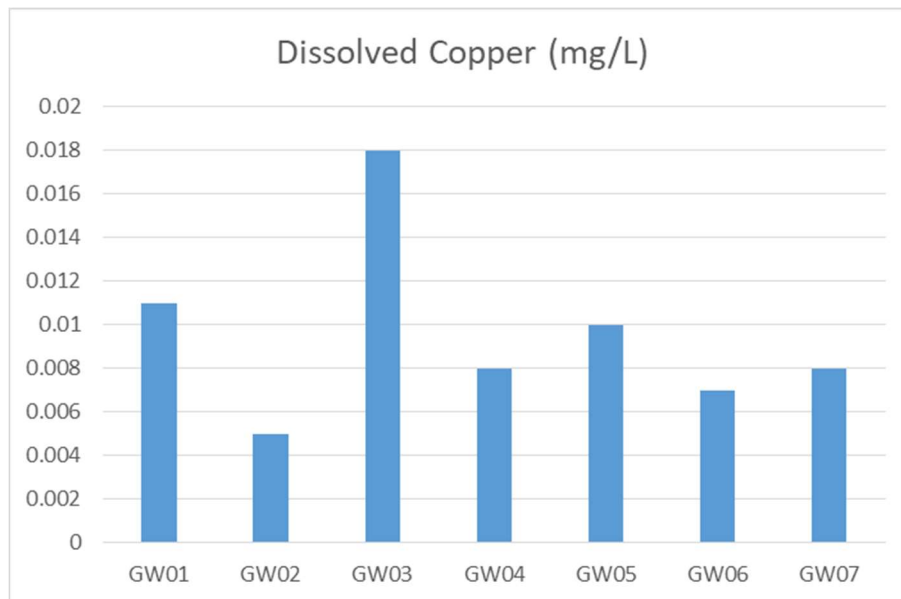


Figure 13: Dissolved Copper May 2021

The levels of Dissolved Copper were only elevated at GW03 which does not occur near operational cells, while all other piezometers recorded low concentrations.

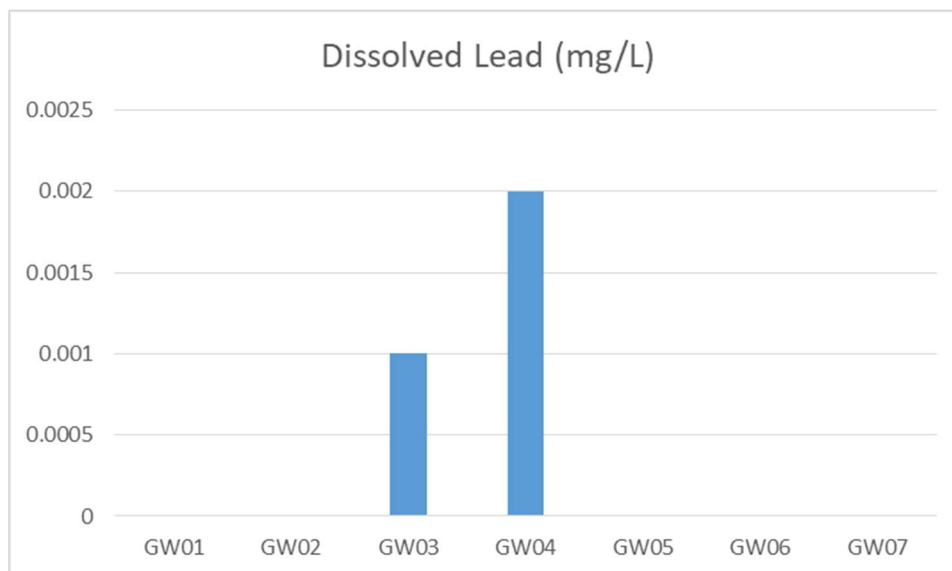


Figure 14: Dissolved Lead May 2021

The levels of Dissolved Lead were only elevated at GW03 and GW04, while all other piezometers recorded “below detect” concentrations.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

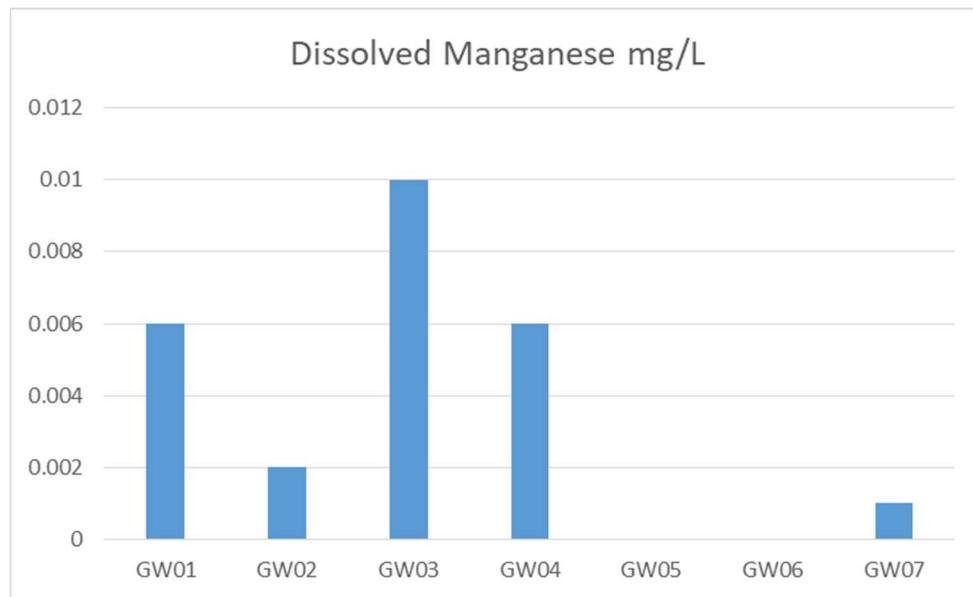


Figure 15: Dissolved Manganese May 2021

The levels of Dissolved Manganese were elevated at GW01 down gradient to the recent operational cells, and GW03 and GW04 up gradient of operations while all other piezometers recorded low concentrations.

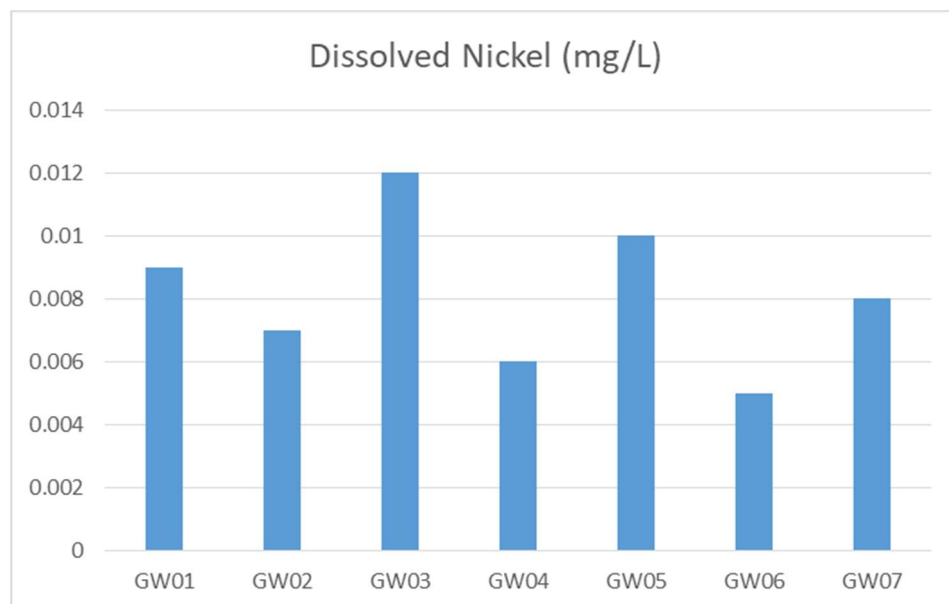


Figure 16: Dissolved Nickel May 2021

The levels of Dissolved Nickel were similar between all piezometers.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

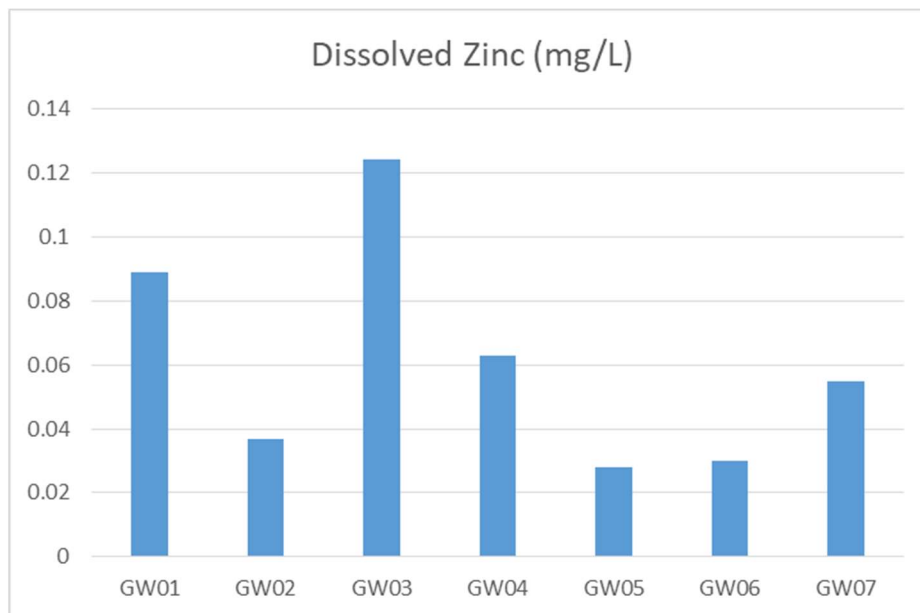


Figure 17: Dissolved Zinc May2021

The levels of Dissolved Zinc were elevated at GW01 down gradient of the landfill cell and GW03 a control site.

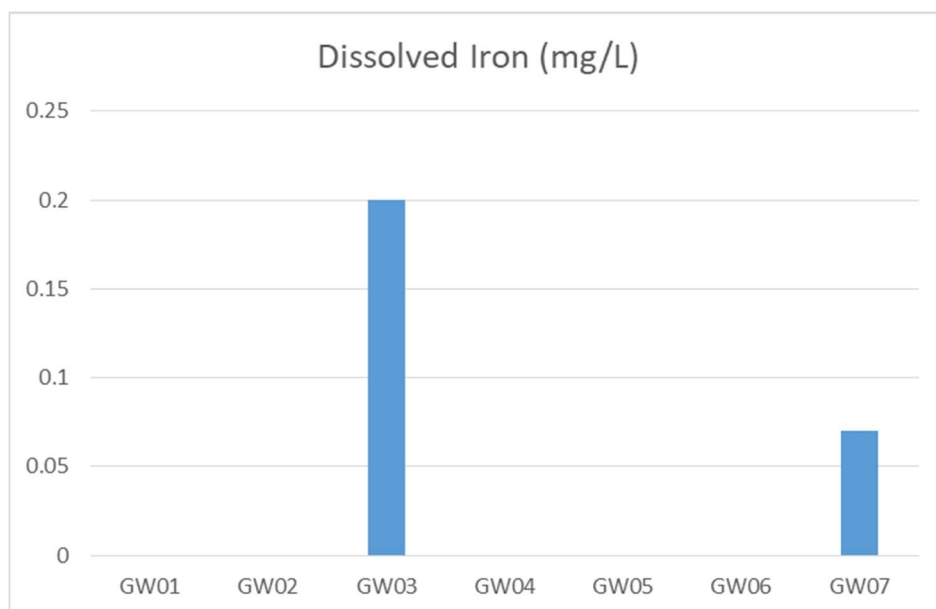


Figure 18: Dissolved Iron May2021

The levels of Dissolved Zinc were elevated GW03 a control site and GW07 on the northern side of the newest cell.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Where a Dissolved metal was recorded below Limit of Recording (LOR) the results were not represented graphically.

Table 7 below details the Metals/Metalloids that were recorded below LOR for each site during the May2021 monitoring period.

Table 7: Groundwater Dissolved Metals below Limit of Recording (LOR) May 2021

Date	Site	Dissolved Arsenic (mg/L)	Dissolved Cadmium (mg/L)	Dissolved Chromium (mg/L)	Dissolved Selenium (mg/L)
25/05/2021	GW01	<0.001	<0.0001	<0.001	<0.01
25/05/2021	GW02	<0.001	<0.0001	<0.001	<0.01
25/05/2021	GW03	<0.001	<0.0001	<0.001	<0.01
25/05/2021	GW04	<0.001	<0.0001	<0.001	<0.01
26/05/2021	GW05	<0.001	<0.0001	<0.001	<0.01
26/05/2021	GW06	<0.001	<0.0001	<0.001	<0.01
26/05/2021	GW07	<0.001	<0.0001	<0.001	<0.01

Arsenic, Cadmium, Chromium and Selenium (Dissolved all recorded levels below the LOR at each of the seven (7) piezometers). Results in Blue designate below LOR.

The results for Metals and metalloids recorded to date (2016 -2021) for each Piezometer are tabulated in Appendix B for comparison.

3.2.4 Groundwater Ammonia, Nitrogen and Phosphorus Results May 2021

Table 8: Groundwater Ammonia, Nitrogen and Phosphorus May 2021

Date	Site	Ammonia as N (mg/L)	Total Nitrogen as N (mg/L)	Total Phosphorus as P (mg/L)
25/05/2021	GW01	0.01	0.1	0.01
25/05/2021	GW02	8.68	14.8	0.11
25/05/2021	GW03	1.61	1.7	0.01
25/05/2021	GW04	1.3	1.3	<0.01
26/05/2021	GW05	1.01	1.1	0.04
26/05/2021	GW06	0.45	0.9	<0.01
26/05/2021	GW07	0.75	1	<0.01

Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021

3.2.5 Total Petroleum/Total Recoverable /Polynuclear Aromatic Hydrocarbons and BTEXN Results May 2021

Table 9: Groundwater Total Petroleum/Total Recoverable /Polynuclear Aromatic Hydrocarbons
and BTEXN Results May 2021

Analyte	Unit	LOR	GW01	GW02	GW03	GW04	GW05	GW06	GW07
Total Petroleum Hydrocarbons									
C6 - C9 Fraction	µg/L	20	<20	<20	<20	<20	<20	<20	<20
C10 - C14 Fraction	µg/L	50	<50	<50	<50	<50	<50	<50	<50
C15 - C28 Fraction	µg/L	100	210	<100	<100	<100	<100	<100	<100
C29 - C36 Fraction	µg/L	50	<50	<50	<50	<50	<50	<50	<50
C10 - C36 Fraction (sum)	µg/L	50	210	<50	<50	<50	<50	<50	<50
Total Recoverable Hydrocarbons									
C6 - C10 Fraction	µg/L	20	<20	<20	<20	<20	<20	<20	<20
C6 - C10 Fraction minus BTEX (F1)	µg/L	20	<20	<20	<20	<20	<20	<20	<20
>C10 - C16 Fraction	µg/L	100	<100	<100	<100	<100	<100	<100	<100
>C16 - C34 Fraction	µg/L	100	200	<100	<100	<100	<100	<100	<100
>C34 - C40 Fraction	µg/L	100	<100	<100	<100	<100	<100	<100	<100
>C10 - C40 Fraction (sum)	µg/L	100	200	<100	<100	<100	<100	<100	<100
>C10 - C16 Fraction minus Naphthalene	µg/L	100	<100	<100	<100	<100	<100	<100	<100

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Polynuclear Aromatic Hydrocarbons									
Naphthalene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Acenaphthylene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Acenaphthene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Fluorene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Phenanthrene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Anthracene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Fluoranthene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Pyrene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Benz(a)anthracene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Chrysene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Benzo(b+j)fluoranthene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Benzo(k)fluoranthene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Benzo(a)pyrene	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Indeno(1.2.3.cd)pyrene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Dibenz(a,h)anthracene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Benzo(g,h,i)perylene	µg/L	1	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0	<1.0
Sum of polycyclic aromatic hydrocarbons	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Benzo(a)pyrene TEQ (zero)	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
BTEXN									
Benzene	µg/L	1	<1	<1	<1	<1	<1	<1	<1
Toluene	µg/L	2	<2	<2	<2	<2	<2	<2	<2
Ethylbenzene	µg/L	2	<2	<2	<2	<2	<2	<2	<2
meta- & para-Xylene	µg/L	2	<2	<2	<2	<2	<2	<2	<2
ortho-Xylene	µg/L	2	<2	<2	<2	<2	<2	<2	<2
Total Xylenes	µg/L	2	<2	<2	<2	<2	<2	<2	<2
Sum of BTEX	µg/L	1	<1	<1	<1	<1	<1	<1	<1
Naphthalene	µg/L	5	<5	<5	<5	<5	<5	<5	<5

Results in Blue designate below LOR

Table g shows that the only Hydrocarbons and BTEXn results were detected at GWo1.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Table 10: Groundwater PCBs and Pesticides May 2021

Table 10 shows the Total PCBs and Pesticide Results May 2021

Analyte	Unit	LOR	GW01	GW02	GW03	GW04	GW05	GW06	GW07
Polychlorinated Biphenyls (PCB)									
Total Polychlorinated biphenyls	µg/L	1	<1	<1	<1	<1	<1	<1	<1
Organochlorine Pesticides									
alpha-BHC	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Hexachlorobenzene (HCB)	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
beta-BHC	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
gamma-BHC	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
delta-BHC	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Heptachlor	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Aldrin	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Heptachlor epoxide	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
trans-Chlordane	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
alpha-Endosulfan	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
cis-Chlordane	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Dieldrin	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
4,4'-DDE	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Endrin	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
beta-Endosulfan	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
4,4'-DDD	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Endrin aldehyde	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Endosulfan sulfate	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
4,4'-DDT	µg/L	2	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0
Endrin ketone	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Methoxychlor	µg/L	2	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0
Total Chlordane (sum)	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Sum of DDD + DDE + DDT	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Sum of Aldrin + Dieldrin	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Organophosphate Pesticides									
Dichlorvos	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Demeton-S-methyl	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Monocrotophos	µg/L	2	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0
Dimethoate	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Analyte	Unit	LOR	GW01	GW02	GW03	GW04	GW05	GW06	GW07
Diazinon	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Chlorpyrifos-methyl	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Parathion-methyl	µg/L	2	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0
Malathion	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Fenthion	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Chlorpyrifos	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Parathion	µg/L	2	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0	<2.0
Pirimphos-ethyl	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Chlorfenvinphos	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Bromophos-ethyl	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Fenamiphos	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Prothiofos	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Ethion	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Carbophenothion	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5
Azinphos Methyl	µg/L	0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5	<0.5

Discussion and Recommendations

4.1 Landfill Gas Monitoring

The Landfill Gas results demonstrate that the landfill continues to generate significant percentages of Methane in the closed and capped landfill cells. The gas composition are similar in Methane, CO₂, CO, H₂S levels between 2016 and 2021

The three Leachate/Landfill gas bores (LL01/LL02/LL03) situated on the edge of the landfill again recorded no Methane (0.0 -0.0%) and extremely low levels of Hydrogen Sulphide (1ppm). Neither of these correlate to typical Landfill gas concentrations and therefore indicate that there is little to no horizontal landfill gas migration beyond the sealed landfill gas cells. This is supported by the high concentrations Landfill Gas generated by the landfill is well contained in the capped landfill cells of Methane recorded in the capped Landfill cells and the lack of landfill gases recorded in the Leachate/LFG bores on the edge of the landfill. This containment is presumed to be due to the high percentage of Kaolinite clays in the soils used for the landfill capping.

4.2 Surface Water Monitoring

As detailed in the methodology, the site has only contains ephemeral water channels and no permanent standing water bodies.

4.3 Leachate Monitoring

During the May 2021 monitoring two leachate bores contained water to enable the collection of samples for leachate monitoring. As the monsoonal weather patterns were well below average for the 2019 and 2020 periods and therefore low infiltration into both the natural substrate and landfill cells this lack of leachate is to be expected. Notwithstanding previous results as detailed in Appendix B also show little or infrequent leachate/groundwater in these piezometers.

4.4 Groundwater Monitoring

The recorded groundwater heights showed an increase in water levels in the May 2021 results in all but two piezometers (GW03 and GW04) with heights generally 3-4m above the originals heights after installation. The drops in water levels at GW03 and GW04 are unexplained, but as these are generally at higher elevations it could reflect movement since rainfall periods

These results are consistent with the above average rainfall described by BOM during the 2020-2021 Monsoonal periods. Previous years were affected by both the Indian Ocean Dipole and neutral to slightly positive El nino weather patterns experienced at Gove however conditions returned to La nina influences across the NT. As the climate predictions are for a La Nina event the 2021-2022 monsoon is expected to provide a level of rainfall replenishing the groundwater reserves and potentially, depending upon the local rainfall recorded – returning groundwater levels to 2016 equivalences.

The results of the Groundwater monitoring did not demonstrate the extreme variability in numerous analytes in previous years due to the increased rainfall in 2020/2021. The variance across the sites did not show clear trends between natural or background levels except at GW01. This piezometer is an old piezometer installed greater than 10 years ago and purged during the installation program in 2016. This piezometer is located within 5m of the most recently completed Landfill Cell and as such is more

Gove Peninsula Waste Management Facility – Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021

likely to represent some very localised leachate migration rather than contamination of the larger groundwater resource as discussed in the following sections.

4.4.1 Physicochemical results

The Groundwater pH was relatively consistent across all piezometers however the recorded Electrical Conductivity (EC) varied across piezometers with the highest results recorded at GW03 which is not located near any current or former landfill cell. This result appears to be an anomalous result in localised water chemistry as there is no defined pathway based on hydrological gradients from the landfill impacts. The second highest EC level was however at GW01, directly down gradient to the recent operational cells. Similar to the recorded Electrical Conductivity (EC), TDS varied across piezometers however the piezometers with the highest results were again GW01 and GW03.

The alkalinity Sulphate, Chloride and Calcium also followed the trends of the EC with again GW03 recording highest Chloride levels despite being a significant distance from any cell. GW01 down gradient to the recent operational cells also showed some elevation in Alkalinity, Sulphate, Chloride and Calcium.

4.4.2 Dissolved Metals

Dissolved Magnesium were elevated at GW01 down gradient to the recent operational cells while all other piezometers recorded low concentrations. The levels of Dissolved Manganese were elevated at GW01 down gradient to the recent operational cells, and GW03 and GW04 up gradient of operations while all other piezometers recorded low concentrations. As such there is little in terms of trends for a number of the metals except that GW01 generally records higher concentrations.

The levels of Dissolved Aluminium were lowest at GW01, GW02 both down gradient to the landfill cells and GW05 a “control piezometer”, while all other piezometers recorded low concentrations. The levels of Dissolved Lead were only elevated at GW03 and GW04 both not impacted by landfill operations, while all other piezometers recorded below detect concentrations. The levels of Dissolved Nickel were elevated at GW03 and slightly elevated at GW05 up-gradient of operations similar to GW01, while all other piezometers recorded low concentrations.

Upon reviewing all data – it is clear that the down gradient piezometer GW01 has a water chemistry influenced by the Landfill as this is showing elevated results in some metals, however as this is extremely close (<10m) to the landfill it does not provide a good indication of contaminants moving off site. the other ‘close’ downgradient piezometer GW02 has not recorded similar elevated results. Also where an analyte is found to be elevated at GW02 the same analyte is elevated at up gradient or “control piezometers” therefore showing natural variation in water chemistry and not significant movement of soluble metaloids as a result of the landfill.

4.4.3 Hydrocarbon, BTEX, PCB and Pesticide contamination.

The results of the 2020 monitoring program demonstrate that the landfill cells are not contributing the contamination of groundwater for Polynuclear Aromatic Hydrocarbons and BTEXN, Polychlorinated Biphenyls (PCB) Organochlorine Pesticides or Organophosphate Pesticides with all results at all piezometers returning results below LORs.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

The only recorded Hydrocarbons were the detection of Total Petroleum and Total Recoverable Hydrocarbons at GWo1 and as these were not recorded at GWo2 it indicates that the contamination is extremely localised and not contributing to local contamination of the groundwater resource. .

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Conclusion

The Landfill Gas sampling results determined that the landfill gas is contained within the landfill cells with little migration due to the capping materials used. As such the risks of explosion and other human health or environmental impacts from the site are considered low. Notwithstanding long term passive landfill gas management measures such as Biofilters or Biocover should be investigated once additional landfill gas monitoring has been conducted and that this Landfill Gas assessment be updated based on the additional data.

The Groundwater monitoring results demonstrate that the landfill leachate is not migrating from the site with most down gradient bores recording similar water quality levels for contaminants as those up gradient of the landfill. The monitoring to date has recorded only one piezometer GWO1 recording elevated contaminants, this piezometer is within 5 m from the south western corner of Landfill cell 2, and shows some migration of leachate but is believed to be localised and not impacting on the local groundwater resource. Consideration should be made to the installation of an additional piezometer further away from GWO1 in future years.

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

References

GHD 2003. Alcan Gove – Gove Landfill Greenfield Assessment – Geological Investigation Unpublished report to Alcan Gove.

Northern Territory Environment Protection Authority (2013) Guidelines for the Siting, Design and Management of Solid Waste Disposal Sites in the Northern Territory

Northern Territory Environment Protection Authority (2016) Guideline for Reporting on Environmental Monitoring

Northern Territory Environment Protection Authority (2013) Guidelines for Consultants Reporting on Environmental Issues

East Coast Environmental (2016) Gove Peninsula Waste Management Facility -Conceptual Site Model;

East Coast Environmental (2016) Gove Peninsula Waste Management Facility - Landfill Gas Assessment

East Coast Environmental (2020) Gove Peninsula Waste Management Facility – Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2020

Appendix A

Analytical results of Landfill Gas composition

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Analyte grouping/Analyte	Units	LOR	LFG01	LFG02
EP101-S: Reduced Sulphur Compounds in Air				
Hydrogen Sulphide	ppbv	10	<10	<10
Carbonyl Sulfide	ppbv	5	15	29
Dimethyl Sulfide	ppbv	0.5	<10.0	188
Carbon disulfide	ppbv	0.5	11.3	34.3
Methanethiol	ppbv	5	<10	<10
Ethanethiol	ppbv	5	<10	<10
EP101-S: Reduced Sulphur Compounds in Air (Calculated Concentration)				
Hydrogen Sulphide	µg/m ³	30	<600	<600
Carbonyl Sulfide	µg/m ³	10	<200	<200
Dimethyl Sulfide	µg/m ³	1	<20	477
Carbon disulfide	µg/m ³	1.8	<36	107
Methanethiol	µg/m ³	10	<200	<200
Ethanethiol	µg/m ³	10	<200	<200
EP101: VOCs by USEPA Method TO15 (Calculated Concentration)				
Freon 12	µg/m ³	2.5	<50.0	<250
Chloromethane	µg/m ³	1	<20.0	<100
Freon 114	µg/m ³	3.5	<70.0	<350
Vinyl chloride	µg/m ³	1.3	774	<130
Bromomethane	µg/m ³	1.9	<38.0	<190
Chloroethane	µg/m ³	1.3	<26.0	<130
Freon 11	µg/m ³	2.8	<56.0	<280
1.1-Dichloroethene	µg/m ³	2	<40.0	<200
Dichloromethane	µg/m ³	1.7	<34.0	<170
Freon 113	µg/m ³	3.8	<76.0	<380
1.1-Dichloroethane	µg/m ³	2	<40.0	<200
cis-1.2-Dichloroethene	µg/m ³	2	4790	693
Chloroform	µg/m ³	2.4	<48.0	<240
1.2-Dichloroethane	µg/m ³	2	<40.0	255
1.1.1-Trichloroethane	µg/m ³	2.7	<54.0	<270
Benzene	µg/m ³	1.6	540	1370
Carbon Tetrachloride	µg/m ³	3.1	<62.0	<310
1.2-Dichloropropane	µg/m ³	2.3	<46.0	<230
Trichloroethene	µg/m ³	2.7	55.8	<270
cis-1.3-Dichloropropylene	µg/m ³	2.3	<46.0	<230
trans-1.3-Dichloropropene	µg/m ³	2.3	<46.0	<230
1.1.2-Trichloroethane	µg/m ³	2.7	<54.0	<270
Toluene	µg/m ³	1.9	922	10000
1.2-Dibromoethane (EDB)	µg/m ³	3.8	<76.0	<380
Tetrachloroethene	µg/m ³	3.4	<68.0	<340
Chlorobenzene	µg/m ³	2.3	<46.0	<230
Ethylbenzene	µg/m ³	2.2	44700	186000

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Analyte grouping/Analyte	Units	LOR	LFG01	LFG02
meta- & para-Xylene	µg/m ³	4.3	143000	516000
Styrene	µg/m ³	2.1	56.6	<210
1.1.2.2-Tetrachloroethane	µg/m ³	3.4	<68.0	<340
ortho-Xylene	µg/m ³	2.2	58600	187000
4-Ethyltoluene	µg/m ³	2.4	<48.0	<240
Total Xylenes	µg/m ³	6.5	202000	703000
1.3.5-Trimethylbenzene	µg/m ³	2.4	132	265
1.2.4-Trimethylbenzene	µg/m ³	2.4	246	405
1.3-Dichlorobenzene	µg/m ³	3	<60.0	<300
Benzylchloride	µg/m ³	2.6	<52.0	<260
1.4-Dichlorobenzene	µg/m ³	3	1690	3000
1.2-Dichlorobenzene	µg/m ³	3	<60.0	<300
1.2.4-Trichlorobenzene	µg/m ³	3.7	<74.0	<370
Hexachlorobutadiene	µg/m ³	5.3	<106	<530
Acetone	µg/m ³	1.2	<24.0	<120
Bromodichloromethane	µg/m ³	3.4	<68.0	<340
1.3-Butadiene	µg/m ³	1.1	<22.0	<110
Carbon disulfide	µg/m ³	1.6	33.9	<160
2-Chlorotoluene	µg/m ³	2.6	<52.0	<260
1-Chloro-2-propene (Allyl chloride)	µg/m ³	1.6	<32.0	<160
Cyclohexane	µg/m ³	1.7	1400	1270
Dibromochloromethane	µg/m ³	4.3	<86.0	<430
1.4-Dioxane	µg/m ³	1.8	<36.0	<180
Ethylacetate	µg/m ³	1.8	<36.0	<180
trans-1.2-Dichloroethene	µg/m ³	2	46	<200
Heptane	µg/m ³	2	1160	2030
Hexane	µg/m ³	1.8	490	528
Isooctane	µg/m ³	2.3	607	1020
Isopropyl Alcohol	µg/m ³	1.2	<24.0	1530
2-Butanone (MEK)	µg/m ³	1.5	64.8	395
Methyl iso-Butyl ketone	µg/m ³	2	51.6	368
2-Hexanone (MBK)	µg/m ³	2	<40.0	<200
Propene	µg/m ³	0.9	4680	12100
Methyl tert-Butyl Ether (MTBE)	µg/m ³	1.8	<36.0	<180
Tetrahydrofuran	µg/m ³	1.5	44.8	<150
Bromoform	µg/m ³	5.2	<104	<520
Vinyl Acetate	µg/m ³	1.8	<36.0	<180
Vinyl bromide	µg/m ³	2.2	<44.0	<220
Ethanol	µg/m ³	0.9	66.3	3410
Acetonitrile	µg/m ³	0.8	<16.0	<80.0
Acrolein	µg/m ³	1.1	<22.0	<110
Acrylonitrile	µg/m ³	1.1	<22.0	<110

**Gove Peninsula Waste Management Facility –
Leachate, Surface Water, Groundwater and Landfill Gas Monitoring Report 2021**

Analyte grouping/Analyte	Units	LOR	LFG01	LFG02
tert-Butyl alcohol	µg/m ³	1.5	<30.0	<150
2-Chloro-1.3-butadiene	µg/m ³	1.8	<36.0	<180
Di-isopropyl Ether	µg/m ³	2.1	<42.0	<210
Ethyl tert-Butyl Ether (ETBE)	µg/m ³	2.1	<42.0	<210
tert-Amyl Methyl Ether (TAME)	µg/m ³	2.1	<42.0	<210
Methyl Methacrylate	µg/m ³	2.1	<42.0	<210
1.1.1.2-Tetrachloroethane	µg/m ³	3.4	<68.0	<340
Isopropylbenzene	µg/m ³	2.4	919	3270
n-Propylbenzene	µg/m ³	2.4	241	<240
tert-Butylbenzene	µg/m ³	2.7	<54.0	<270
sec-Butylbenzene	µg/m ³	2.7	<54.0	<270
2-isopropyltoluene	µg/m ³	2.7	<54.0	<270
n-Butylbenzene	µg/m ³	2.7	<54.0	<270
Naphthalene	µg/m ³	2.6	<52.0	<260
EP104: Light Hydrocarbons				
Methane	Mol %	0.05	51.3	62.6
EP104: Light Hydrocarbons (Calc Conc)				
Methane	mg/m ³	330	335000	409000
EP104: Permanent Gases				
Carbon Dioxide	Mol %	0.05	16.4	30
Oxygen	Mol %	0.1	<0.20	<0.20
EP104: Permanent Gases (Calc Conc)				
Carbon Dioxide	mg/m ³	900	294000	540000
Oxygen	mg/m ³	1310	<2620	<2620
Sampling Quality Assurance				
Pressure - As received	kPaa	0.1	95.9	98.2
Pressure - Laboratory Atmosphere	kPaa	0.1	103	103
Temperature as Received	°C	0.1	20	20

Appendix B

Analytical results – Dissolved Metals and Metalloids levels recorded at GW01 2016-2021

Table B1 – Dissolved Metals and Metalloids levels recorded at GW01 2016-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
20/07/2016	-	-	-	-	<0.001	<0.0001	<0.001	0.001	<0.001	-	0.013	-	0.023	-
14/08/2017	18	59	11	<0.01	<0.001	<0.0001	0.002	0.001	<0.001	0.007	0.002	<0.01	0.02	<0.05
26/06/2018	22	68	14	<0.01	<0.001	<0.0001	<0.001	0.002	<0.001	0.009	0.007	<0.01	0.045	0.16
24/09/2019	20	75	14	<0.01	<0.001	<0.0001	<0.001	0.002	<0.001	0.008	0.003	<0.01	0.043	<0.05
9/09/2020	20	75	15	<0.01	<0.001	<0.0001	<0.001	0.001	<0.001	0.008	0.011	<0.01	0.036	<0.05
25/05/2021	22	83	17	<0.01	<0.001	<0.0001	<0.001	0.011	<0.001	0.006	0.009	<0.01	0.089	<0.05

Table B2 – Dissolved Metals and Metalloids levels recorded at GW02 2016-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
20/07/2016	-	-	-	-	<0.001	<0.0001	<0.001	<0.001	0.002	-	0.019	-	0.022	-
14/08/2017	3	31	<1	0.06	<0.001	<0.0001	0.001	0.006	0.002	0.005	0.013	<0.01	0.041	<0.05
26/06/2018	3	31	<1	0.05	<0.001	<0.0001	<0.001	0.005	0.002	0.003	0.01	<0.01	0.032	<0.05
24/09/2019	2	14	<1	0.03	<0.001	<0.0001	<0.001	0.01	0.005	0.003	0.023	<0.01	0.067	<0.05
9/09/2020	4	40	<1	0.05	<0.001	<0.0001	<0.001	0.006	0.002	0.002	0.025	<0.01	0.046	<0.05
25/05/2021	2	41	<1	<0.01	<0.001	<0.0001	<0.001	0.005	<0.001	0.002	0.007	<0.01	0.037	<0.05

Table B3 – Dissolved Metals and Metaloids levels recorded at GW03 2016-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
20/07/2016	-	-	-	-	<0.001	<0.0001	<0.001	0.006	0.007	-	0.014	-	0.096	-
14/08/2017	2	188	3	0.02	<0.001	<0.0001	<0.001	0.002	<0.001	0.007	0.018	<0.01	0.015	0.06
26/06/2018	3	180	3	0.06	<0.001	<0.0001	<0.001	0.002	0.002	0.016	0.035	<0.01	0.053	0.1
24/09/2019	5	266	4	0.06	<0.001	<0.0001	<0.001	<0.001	0.001	0.036	0.025	<0.01	0.027	0.18
9/09/2020	3	174	3	0.02	<0.001	<0.0001	<0.001	0.002	<0.001	0.012	0.006	<0.01	0.052	0.26
25/05/2021	2	150	3	0.02	<0.001	<0.0001	<0.001	0.018	0.001	0.01	0.012	<0.01	0.124	0.2

Table B4 – Dissolved Metals and Metaloids levels recorded at GW04 2016-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
20/07/2016	-	-	-	-	<0.001	<0.0001	0.001	0.004	0.0024	-	0.015	-	0.076	-
14/08/2017	3	15	1	0.01	<0.001	<0.0001	0.003	<0.001	0.001	0.016	0.002	<0.01	0.014	0.55
26/06/2018	3	15	1	0.02	<0.001	<0.0001	<0.001	0.001	<0.001	0.006	0.007	<0.01	0.032	0.09
24/09/2019	4	26	2	0.02	<0.001	<0.0001	<0.001	<0.001	0.002	0.006	0.006	<0.01	0.016	0.06
9/09/2020	4	36	2	0.06	<0.001	<0.0001	<0.001	0.002	0.004	0.009	0.006	<0.01	0.026	<0.05
25/05/2021	4	28	2	0.06	<0.001	<0.0001	<0.001	0.008	0.002	0.006	0.006	<0.01	0.063	<0.05

Table B5 – Dissolved Metals and Metalloids levels recorded at GW05 2016-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
20/07/2016	-	-	-	-	<0.001	<0.0001	<0.001	0.001	0.004	-	0.009	-	0.029	-
14/08/2017	1	13	<1	0.03	<0.001	<0.0001	0.006	0.002	0.002	0.004	0.01	<0.01	0.01	<0.05
26/06/2018	1	14	<1	<0.01	<0.001	<0.0001	<0.001	<0.001	<0.001	<0.001	0.002	<0.01	<0.005	<0.05
24/09/2019	1	11	<1	0.02	<0.001	<0.0001	<0.001	0.014	<0.001	0.002	0.002	<0.01	0.03	<0.05
9/09/2020	<1	11	<1	<0.01	<0.001	<0.0001	<0.001	0.001	<0.001	<0.001	0.014	<0.01	0.011	<0.05
26/05/2021	1	10	<1	0.01	<0.001	<0.0001	<0.001	0.01	<0.001	<0.001	0.01	<0.01	0.028	<0.05

Table B6 – Dissolved Metals and Metalloids levels recorded at GW06 2016-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
20/07/2016	-	-	-	-	<0.001	<0.0001	<0.001	<0.001	0.004	-	0.013	-	0.019	-
14/08/2017	3	16	<1	0.02	<0.001	<0.0001	<0.001	0.006	0.004	0.001	0.01	<0.01	0.023	<0.05
26/06/2018	4	16	<1	0.04	<0.001	<0.0001	<0.001	0.036	0.002	0.002	0.009	<0.01	0.12	<0.05
24/09/2019	3	20	<1	0.04	<0.001	<0.0001	0.005	0.005	0.002	0.005	0.02	<0.01	0.01	<0.05
9/09/2020	3	15	<1	0.02	<0.001	<0.0001	<0.001	0.003	<0.001	<0.001	0.004	<0.01	0.009	<0.05
26/05/2021	4	15	<1	0.02	<0.001	<0.0001	<0.001	0.007	<0.001	<0.001	0.005	<0.01	0.03	<0.05

Table B7 – Dissolved Metals and Metalloids levels recorded at GW07 2016-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
20/07/2016	-	-	-	-	<0.001	<0.0001	<0.001	<0.001	0.002	-	0.014	-	0.024	-
14/08/2017	<1	18	<1	0.04	<0.001	<0.0001	0.005	0.001	0.004	0.004	0.016	<0.01	0.012	0.09
26/06/2018	<1	19	<1	0.03	<0.001	<0.0001	<0.001	0.004	0.002	0.004	0.009	<0.01	0.085	<0.05
24/09/2019	<1	22	<1	0.04	<0.001	<0.0001	<0.001	0.001	<0.001	0.001	0.012	<0.01	0.013	<0.05
9/09/2020	<1	20	<1	0.04	<0.001	<0.0001	<0.001	0.001	<0.001	0.001	0.004	<0.01	0.018	<0.05
26/05/2021	<1	18	<1	0.05	<0.001	<0.0001	<0.001	0.008	<0.001	0.001	0.008	<0.01	0.055	0.07

Table B8 – Dissolved Metals and Metalloids levels recorded at LL01 2017-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
14/08/2017	21	72	13	0.04	<0.001	<0.0001	0.003	<0.001	<0.001	0.009	<0.001	<0.01	<0.005	0.36
26/06/2018	25	80	14	0.02	<0.001	<0.0001	<0.001	<0.001	<0.001	0.009	0.001	<0.01	<0.005	0.06
24/09/2019	18	71	11	0.03	<0.001	<0.0001	<0.001	<0.001	<0.001	0.004	<0.001	<0.01	<0.005	<0.05

Table B9 – Dissolved Metals and Metalloids levels recorded at LL02 2017-2021

Date	Magnesium	Sodium	Potassium	Aluminium	Arsenic	Cadmium	Chromium	Copper	Lead	Manganese	Nickel	Selenium	Zinc	Iron
	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L
LOR	1	1	1	0.01	0.001	0.0001	0.001	0.001	0.001	0.001	0.001	0.01	0.005	0.05
14/08/2017	24	103	19	0.01	<0.001	<0.0001	<0.001	0.002	<0.001	0.005	0.001	<0.01	0.008	<0.05
26/06/2018	26	104	21	0.01	<0.001	<0.0001	<0.001	0.002	<0.001	0.024	0.002	<0.01	0.007	<0.05

